




Smoke and Dye-Water Observation Summary

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

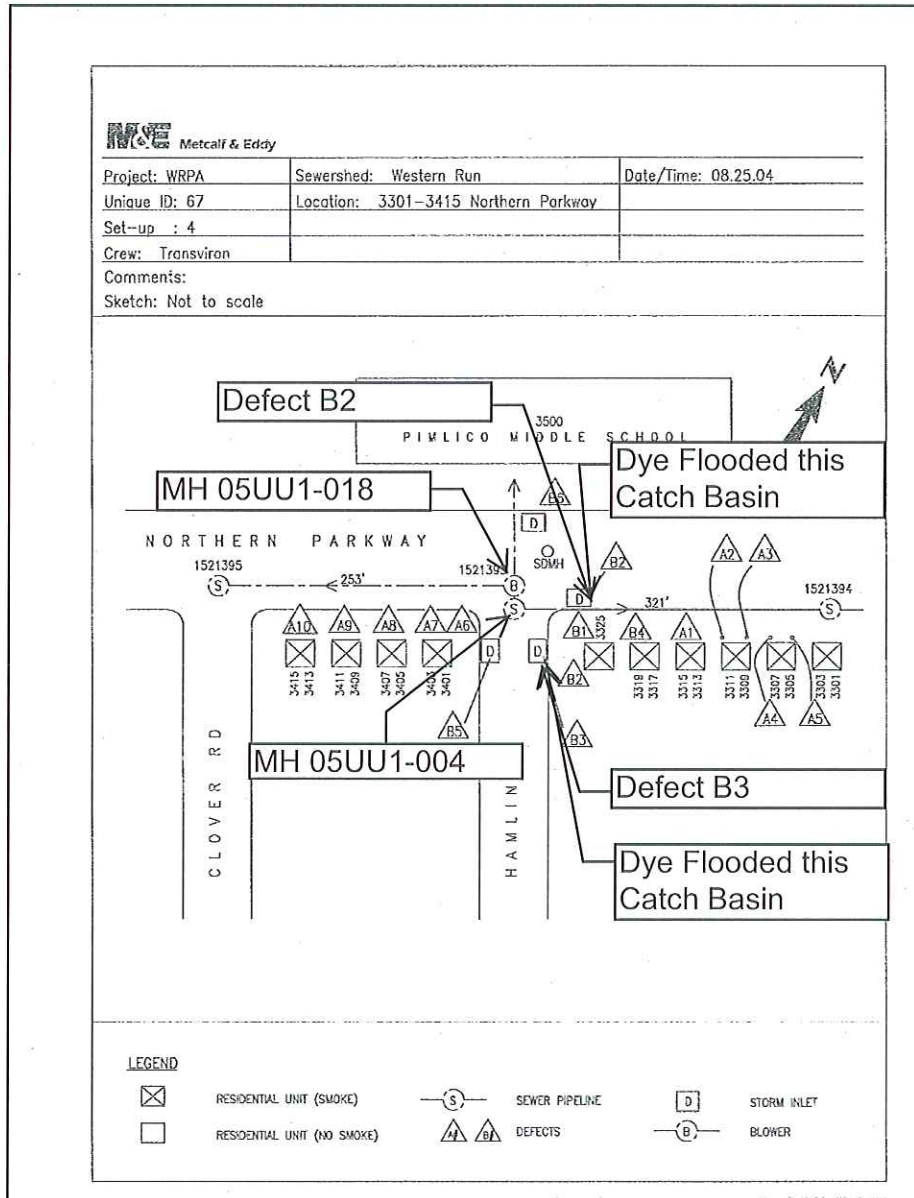

Sketch No: 67

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\67.tif

Image Status: Image found and displayed.


NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.

DYE TESTING FORM

Sketch (NTS)

Dye Test 67

Show North Arrow

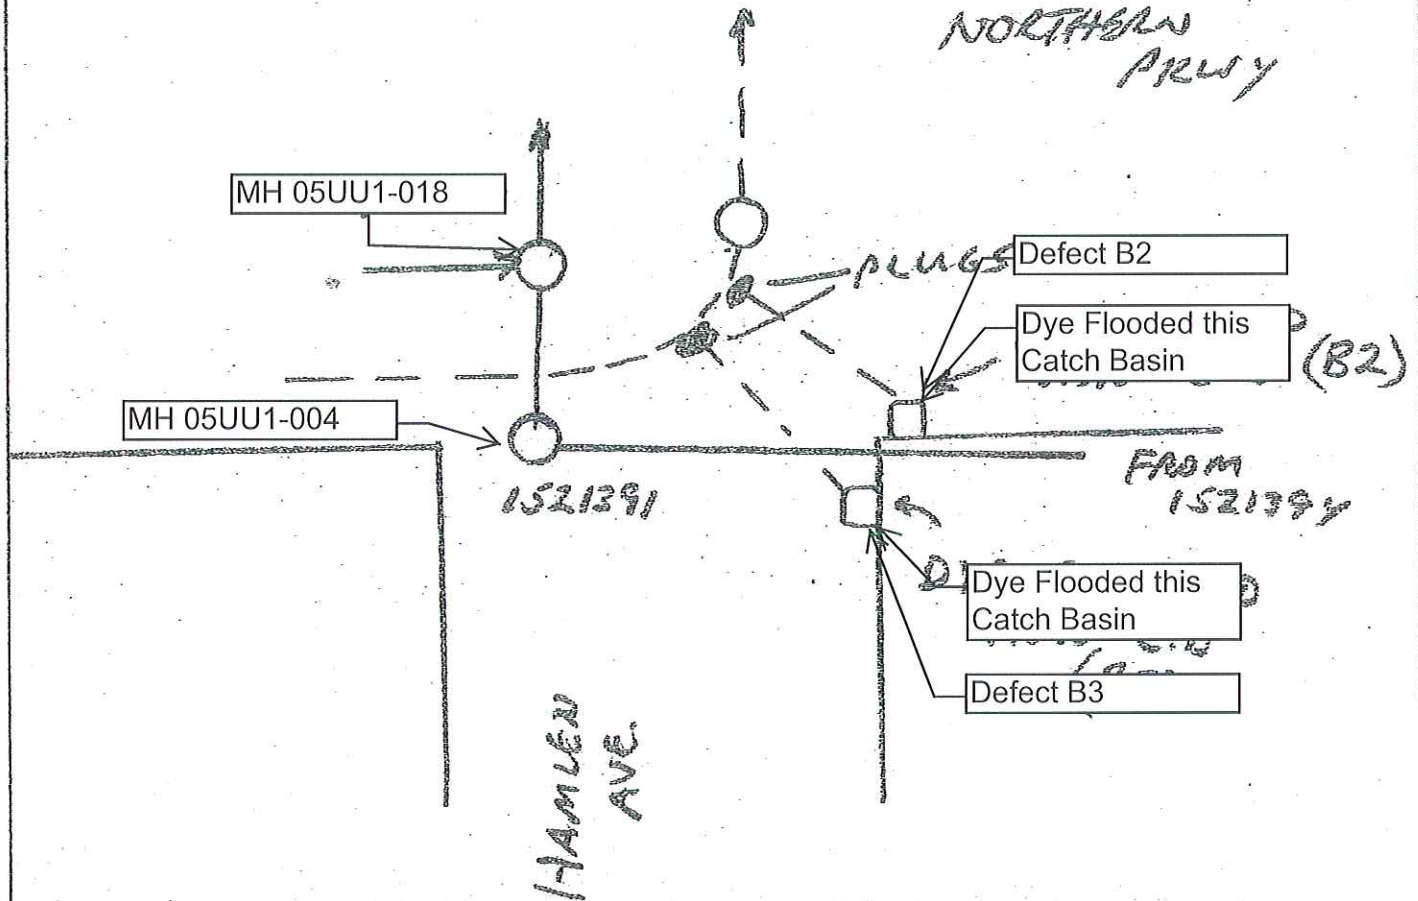


RESULT CODES		SOURCE TYPE CODES		
1. POSITIVE	1. MAIN SEWER	5. DOWN SPOUT	9. STAIRWELL DRAI	13. STORM DRAIN
2. NEGATIVE	2. SERVICE LINE	6. DWNSPT CONN.	10. FOUNDATION DRAIN	14. CATCH BASIN
3. CANNOT TEST	3. TRANSITION JOIN	7. AREA DRAIN	11. BUILDING INTERIOR	15. STORM MH
	4. CLEAN OUT	8. DRIVEWAY DRAIN	12. MH FRAME/SEAL	16. STORM DITCH
Additional Comments: LAMPING THE LINE, THE SAME S.C. LEAKED FROM TEST B2 AS DID FROM B3 BUT WITH LESS INTENSITY. DID NOT TV IT AGAIN.				

10/27

INSPECTION REPORT

DATE: 04/12/2005	WORK ORDER:	WEATHER: SUNNY, DRY	OPERATOR: J.A.M.	SECTION NR: 38	SECTION NAME:
PRESENT:	VEHICLE: TV 175	CAMERA: PAN/TILT	PRESET:	CLEANED: NO	RATE: 575

STREET: NORTHERN PKWY 67 B 3	MAP #1: 1	MH: 1521391
CITY: BALTIMORE	MAP #2:	MH: 1521394
LOCALE: MAIN RESIDENTIAL STREET	TAPE #: JAM 4	TV'D LGTH: 26.16 ft
INSPECT REASON: DYE TESTING	PIPE SIZE: 8 in	
SECTION TYPE: WASTEWATER	MATERIAL: VCP JT LGTH: 3 ft	
AREA: 01-WR21	LINING: MISCELLANEOUS RELINED	
RSRVD:		
REMARK: DYE TEST 67 B 3		

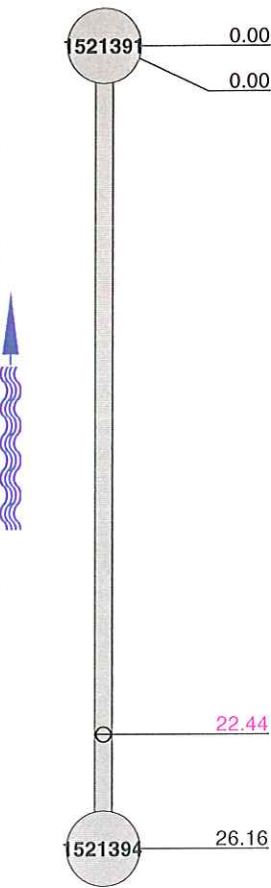1:75	DIST	OBSERVATION	RATE	VCR #	PH
	0.00	inspection begins at downstream manhole, 1521391	0	00:11:17	
	0.00	M.H. WALL LEAKING		00:11:57	
	22.44	service connection with infiltration gushing around at 01 o'clock	00:13:44	17a, b	
	26.16	inspection ends, NO MORE DYE TEST LEAKS SEEN.	0	00:14:30	18a

INSPECTION IMAGES

CITY: BALTIMORE	STREET: NORTHERN PKWY 67 B 3	DATE: 04/12/2005	SECTION NR: 38	SECTION NAME:
--------------------	---------------------------------	---------------------	-------------------	---------------



IMAGE: 17a, TAPE #: JAM 4, 00:13:44
22.44FT, service connection with infiltration gushing around at 01 o'clock



IMAGE: 17b, TAPE #: JAM 4, 00:13:44
22.44FT, service connection with infiltration gushing around at 01 o'clock



IMAGE: 18a, TAPE #: JAM 4, 00:14:30
26.16FT, inspection ends, NO MORE DYE TEST LEAKS SEEN.